
SH420/386TC-BA32 SH420 Tunnel bow/stern thruster hydraulic BA32



Spare parts (valid from 2017-09-29)

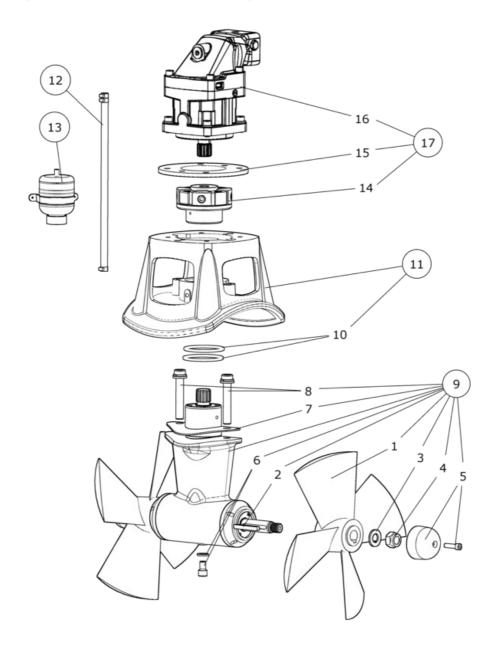

#	Name	Item Code	Description
1	Propeller		50 1270**
2	Propeller key	50 1241	Propeller shaft key SH550
3	Propeller washer	50 1181	Flat washer M20 A4
4	Locknut	50 1260	Lock nut
5	Anode	50 1180 A	Anode kit, aluminium for SP420/550HYD
6	Oil drain screw with gasket	50 1220	Oil plug
7	Gasket (between gearleg and tunnel)	50 1312	Gasket for gearleg installation in tunnel, SP550TC
8	Gearleg bolt	50 1080	Bolt M16 x 100 6kt
9	Complete gearleg	50 0600	Complete gearleg SH550
10	O-ring seals in motor bracket	50 1340	O-ring
11	Complete motor bracket	50 0502	Motor bracket Pro/ Ultra motor SH550
12	Oil hose with hose clamps	20 0400	Oil hose, 2,5m with 3clamps, 327034-12
13	Oil container with bracket	20 0300	Oil container with fastening clip
14	Complete flexible coupling	50 1460 HYD	Complete flexible coupling SH550TC SAEC-SAEC
15	Adaptor plate (U-motors only)	5021301	Adapter flange SP550
16	Hyd. Motor options:		
16a	U-26	72100/U-26	Hydraulic motor 26ccm (G26)
16b	U-29	72100/U-29	Hydraulic motor 29ccm ultra
16c	U-33	72100/U-33	Hydraulic motor 33ccm ultra
16d	U-37	72100/U-37	Hydraulic motor 37ccm ultra
16e	BA 32		72100/BA 32
17	Hyd. Motor assembly options:		
17a	SH420 motor, U-26, complete, w/flex. Coupling	502126UL2	Hydraulic motor SP550-26ccm U
17b	SH420 motor, U-29, complete, w/flex. Coupling	502129UL2	Hydraulic motor SP550-29ccm U
17c	SH420 motor, U-33, complete, w/flex. Coupling	502133UL2	Hydraulic motor SP550-33ccm U
17d	SH420 motor, U-37, complete, w/flex. Coupling	502137UL2	Hydraulic motor SP550-37ccm U
17e	SH420 motor, BA 32, complete, w/flex. Coupling	502132UL	Hydraulic motor SH420-32ccm BentAxis

The installer alone has responsibility for the installation of the spare parts. Side-Power only warranty the spare parts supplied only.

The information given in the document was correct at the time it was published. However, Sleipner Motor AS can not accept liability for any inaccuracies or omissions it may contain. Continuous product improvement may change the product specifications without notice. Therefore, Sleipner Motor AS can not accept liability for any possible differences between product and document.